


American Honda Motor Co., Inc.

SAFETY AND EMISSIONS **RECALL NOTICE**

EU2000i Portable Generators

FUEL TUBE LEAK

Check below to see if your generator is affected by this recall.

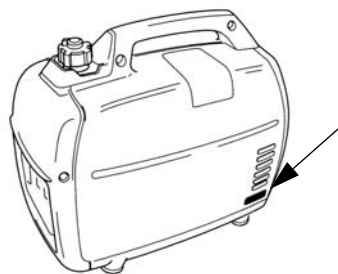

Serial Number
Location

Affected Model	Start Serial Number	End Serial Number
EU2000i	EAAJ-2260273	EAAJ-2485025

Units previously inspected/repared are no longer part of this recall.


They can be identified as follows:



Boxed generators are identified by a "green dot" located on the carton.

Also, one of the markings shown to the right, located inside the spark plug access cover.

Black dot
or Honda sticker
7D1 or 7D2

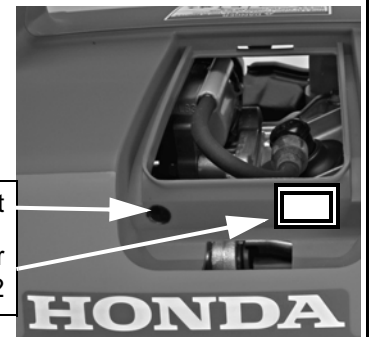

Consumers should immediately stop using the recalled generator and contact a Honda Power Equipment dealer to have it inspected/repared free of charge.

What is the problem?

A tube clamp that connects a fuel tube to the bottom of the fuel tank may have been improperly positioned during assembly, and use of the generator may cause the clamp to wear a hole into an adjacent fuel tube. If the fuel tube is worn sufficiently, gasoline and gasoline vapors may leak out and a fire or explosion could occur.

What should you do?

Stop using any generator within the affected serial number range until it has been repaired. Please contact a servicing Honda Power Equipment dealer to make an appointment to have your generator inspected and if necessary repaired, free of charge. If you need assistance locating a servicing dealer, please visit our website: www.PowerEquipment.Honda.com, or call us at our recall line (888) 888-3139.

In cooperation with the U.S. Consumer Product Safety Commission,
California Air Resources Board, and the Environmental Protection Agency